

Inspection Report

Chief's Order No. 2014-541

Division of Oil and Gas Resources Management (DOGRM)

Date: 5/19/2022

Site Name: Austin Master Services Facility

Location: 801 N. Fourth St., Martins Ferry, Belmont County

Owner: Austin Master Services (AMS), LLC

Contacts: Emergency – Joe Bement, [REDACTED]
Site – Troy Mazur, [REDACTED]

Weather: Approximately 70°F, Cloudy

Arrival/Departure: 10:20 AM / 12:50 PM

Attendees: AMS – Troy Mazur, Brandon Benline & Joe Bement
DOGRM – Tara Lee, Brian Jacoby

Purpose: 2nd Quarter Site Inspection 2022

Inspection/Observations:

- The facility was in operation during the inspection, with trucks entering and leaving.
- Three 500 bbl used vertical tanks were still being stored at the entrance of the facility.
- Storage bin #5 was at 25 percent capacity, storage bin #6 was at 70 percent capacity and storage bin #7 was at 20 percent capacity.
- Cold mixing pit splash panels were in good condition.
- Storage bin #1 was at 50 percent capacity, #2 was at 40 percent capacity and #3 was at 70 percent capacity. These bins contained recently stabilized waste, which was being loaded onto trucks for disposal at the time of the inspection.
- The green 500 bbl frac tank had been relocated to the north end of the building near bins 1 – 3. The intent is to fabricate the tank into an agitator.
- The floor of the facility was free of waste.
- Filter press area was clean underneath.
- A new boot washing station was installed for use by employees and visitors upon exiting the facility. DOGRM staff was frisked upon exit.
- It was reported that the doors are being kept closed to prevent outside dust from entering the building.

Action Items:

- **As a reminder, Austin Master Services needs to obtain an Oil and Gas Waste Facility Permit from DOGRM by 7/13/2022.**

- Submit proposed procedure and secondary containment calculations for the brine weighting process. An Amendment will have to be issued by DOGRM approving the new operations prior to the operation commencing. Ensure truck loading area is contained. This process will be included in the permit application.
- Continue to store waste within each bin's capacity or bring in additional roll-off containers to facilitate proper storage.
- Continue to clean out drain to sump adjacent to storage bins #5, #6 and #7 as needed and keep it free of waste.
- Continue to remove free liquids from the secondary containment for the storage bins.
- Continue with housekeeping protocols and maintain appropriate waste volumes in the concrete containment bins to allow for mixing and storing within the bins.

Photographs:



Boot Washing Station




May 19, 2022 at 10:26:42 AM
1097 N First St
Martins Ferry OH 43935
United States

Relocated green 500 bbl frac tank



May 19, 2022 at 11:13:44 AM
1137-1289 N First St
Martins Ferry OH 43935
United States

Filter Press Solids Processing Bin

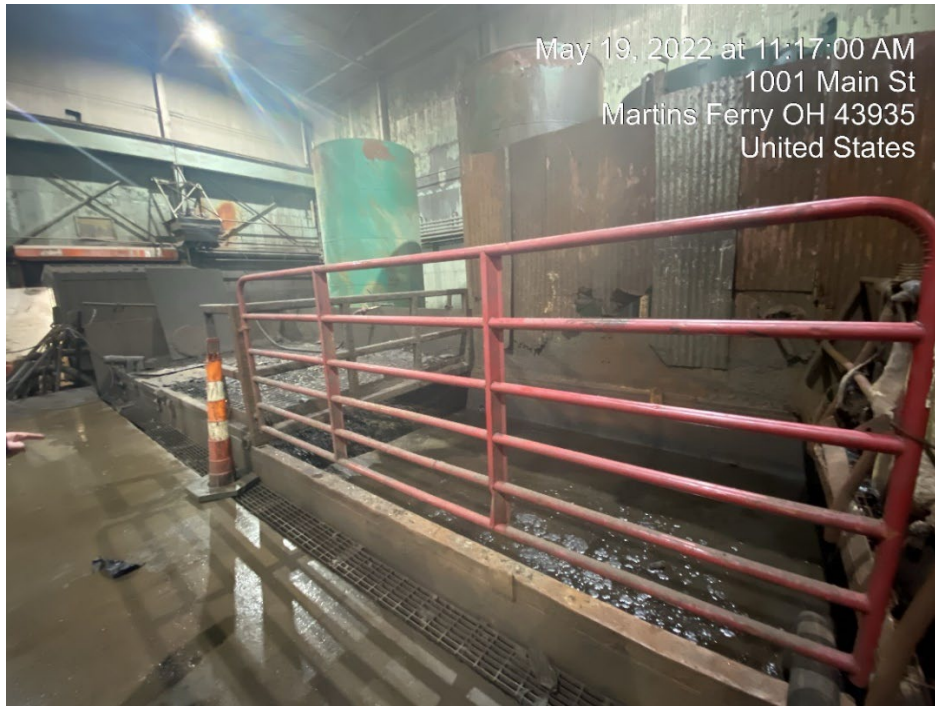

Truck wash area and mixing pit



Cold Mixing Pit Sideview